

Technical Bulletin



Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
Touareg	2004	3.2L (BAA)	All	All	All

Condition

MIL ON, DTC P0420 and/or P0430 Stored in ECM Memory

DTC P0420 Catalyst System Efficiency Below Threshold Bank 1

DTC P0430 Catalyst System Efficiency Below Threshold Bank 2

01 07 08 Jan. 23, 2007 2013789

Technical Background

Improper replacement of secondary catalytic converter.


Production Solution

No production change required.

Technical Bulletin




Service

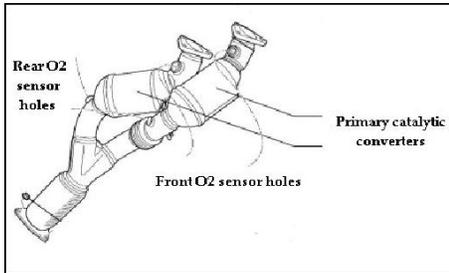

Primary Catalytic Converters

When diagnosing a vehicle with fault codes P0420 and/or P0430, and the diagnosis reveals that the catalytic converters need replacement, replace only the primary catalytic converters.

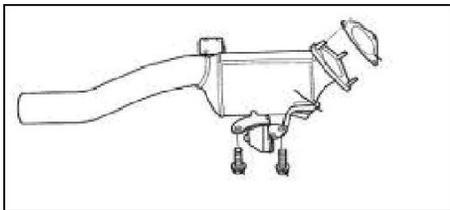

Secondary Catalytic Converter



Tip:

Under normal circumstances it is only necessary to replace the secondary catalytic converter for noises that are caused by internal defects.

Warranty

Information only.

Required Parts and Tools

No Special Parts required. Always see ETKA for the latest part(s) information.

No Special Tools required.